

**DRAFT REPORT**

**DAM SAFETY INSPECTION  
REPORT**

**GORGAS STEAM PLANT  
WALKER COUNTY,  
ALABAMA**

**SUBMITTED TO:**

***U.S. DEPARTMENT OF ENVIRONMENTAL  
PROTECTION AGENCY  
WASHINGTON, DC***

**Engineering & Construction Management  
Hydro-Nuclear-Fossil**

**Geotechnical Engineering**

**Seismic and Structural Engineering**

**Hydrological & Hydraulic Engineering**

**Tunnel Engineering**

**Environmental Engineering & Permitting**

**PAUL C. RIZZO ASSOCIATES, INC.  
101 WESTPARK BOULEVARD, SUITE B  
COLUMBIA, SOUTH CAROLINA USA 29210**

**PROJECT NO. 09-4157  
JULY 2009**

# TABLE OF CONTENTS

|  | PAGE |
|--|------|
| LIST OF TABLES .....   | iii  |
| LIST OF FIGURES .....  | iv   |
| LIST OF APPENDICES .....   | v    |
| 1.0 EXECUTIVE SUMMARY .....  | 1    |
| 1.1 GENERAL .....  | 1    |
| 1.2 SUMMARY OF FIELD INSPECTION FINDINGS .....                             | 2    |
| 1.3 SUMMARY OF O&M STATUS .....  | 2    |
| 1.4 CONCLUSIONS.....   | 3    |
| 1.4.1 Project Description .....  | 3    |
| 1.4.2 Field Inspection .....   | 3    |
| 1.5 SUMMARY OF RECOMMENDATIONS .....                                       | 4    |
| 1.6 CERTIFICATION .....  | 4    |
| 1.6.1 List of All Field Inspection Participants.....                       | 4    |
| 1.6.2 Signature of Independent Engineer .....                              | 5    |
| 1.6.3 PE Stamp .....   | 5    |
| 2.0 PROJECT DESCRIPTION.....   | 6    |
| 2.1 EXISTING PROJECT FEATURES AND HAZARD POTENTIAL<br>CLASSIFICATION ..... | 6    |
| 2.1.1 Rattlesnake Dam and Ash Pond .....                                   | 6    |
| 2.1.2 Gypsum Ponds.....  | 8    |
| 2.2 SUMMARY OF STANDARD OPERATING PROCEDURES .....                         | 9    |
| 2.2.1 Purpose of the Project.....  | 9    |
| 2.2.2 Current Inspection Schedule.....                                     | 10   |
| 2.3 MODIFICATIONS CONDUCTED FOR PROJECT SAFETY .....                       | 10   |
| 3.0 FIELD INSPECTION.....  | 11   |
| 3.1 FIELD INSPECTION OBSERVATIONS .....                                    | 11   |
| 3.1.1 Rattlesnake Dam.....   | 12   |
| 3.1.2 Gypsum Ponds.....  | 13   |

|       |  |    |
|-------|--|----|
| 3.2   | STATUS OF RESPONSES TO RECOMMENDATIONS IN LAST ANNUAL INSPECTION ..... | 13 |
| 3.2.1 | Sapling Removal .....  | 14 |
| 3.2.2 | Maintenance of a Clear Zone at Dam Toe.....                            | 14 |
| 4.0   | RECOMMENDATIONS .....  | 15 |
| 4.1   | RECOMMENDATION NO. 1 .....   | 15 |
| 4.2   | RECOMMENDATION NO. 2.....  | 15 |
| 4.3   | RECOMMENDATION NO. 3.....  | 16 |
| 4.4   | RECOMMENDATION NO. 4.....  | 16 |
| 4.5   | RECOMMENDATION NO. 5.....  | 16 |

TABLES

FIGURES

APPENDICES

## LIST OF TABLES

| TABLE NO.  | TITLE                               | PAGE |
|------------|-------------------------------------|------|
| TABLE 1 -1 | SUMMARY OF RECOMMENDATIONS .....    | 4    |
| TABLE 2 -1 | RATTLESNAKE DAM LOCATION DATA ..... | 8    |
| TABLE 2 -2 | GYPSUM PONDS LOCATION DATA .....    | 9    |

## **LIST OF FIGURES**

| <b>FIGURE NO.</b> | <b>TITLE</b>                             |
|-------------------|--|
| FIGURE 1          | USGS VICINITY MAP                        |
| FIGURE 2          | RATTLESNAKE HOLLOW ASH POND AND FEATURES |
| FIGURE 3          | RATTLESNAKE DAM AND FEATURES             |
| FIGURE 4          | GYPSUM PONDS AND FEATURES                |

## **LIST OF APPENDICES**

| <b>APPENDIX</b> | <b>TITLE</b>          |
|-----------------|-----------------------|
| APPENDIX A      | PHOTO LOG             |
| APPENDIX B      | FIGURES               |
| APPENDIX C      | INSPECTION CHECKLISTS |

**DAM SAFETY INSPECTION REPORT  
WILLIAM CRAWFORD GORGAS ELECTRIC  
GENERATING PLANT  
WALKER COUNTY, ALABAMA  
PROJECT NO. 09-4157**

**1.0 EXECUTIVE SUMMARY**

**1.1 GENERAL**

This Section is a summary of the Independent Engineer's Review of Management Units for the William Crawford Gorgas Electric Generating Plant (Gorgas). The Report was prepared by Paul C. Rizzo Associates Inc (RIZZO) for the United States Environmental Protection Agency (USEPA) under subcontract to Lockheed Martin. This Section summarizes the finding, assessments, conclusions and recommendations of the Independent Engineer.

The Gorgas plant is a coal fired power plant located on the north bank of the Black Warrior River in Parrish, Walker County, Alabama owned and operated by Alabama Power Company. Under normal operating conditions, byproducts of coal combustion including fly ash, bottom ash, boiler slag, flue gas emission control residuals, and other general wastewater products are sluiced into a storage basin south of the plant impounded by Rattlesnake Dam, a rockfill embankment structure with an upper RCC facing block. In addition, gypsum byproducts are sluiced and stored in a basin northwest of the plant consisting of a gypsum storage pond and a series of clarification basins.

The ash pond dam, called Rattlesnake Dam, was originally constructed as a random rockfill structure in 1954 using local borrow materials. The original structure was raised and made larger in 1979, and then raised once again in 2007. Along with raising the ash pond dam in 2007, a series of gypsum and clarification ponds were built. For the purposes of this assessment, Rattlesnake Dam and the Gypsum Ponds have been classified as significant hazard potential structures. Significant hazard potential structures are classified as structures where failure is not likely to result in loss of life, but may cause significant

economic loss, environmental damage, disruption of lifeline facilities, or can impact other concerns. The predominant risk of failure for Rattlesnake Dam and the Gypsum Ponds is environmental damage.

## **1.2 SUMMARY OF FIELD INSPECTION FINDINGS**

The site inspection was conducted on June 9, 2009. The inspection team consisted of representatives from Alabama Power Company (APC), Alabama Department of Environmental Management (ADEM), Balch and Bingham, the USEPA, and RIZZO. The team stopped at each of the project features to inspect the structures and the surrounding area. Particular attention was paid to site features that may contribute to typical failure modes of embankment structures such as settlement, seepage, and slope stability.

The rockfill embankment comprising Rattlesnake Dam and the associated spillway, weir flow discharge structure, and associated piping were found to be well maintained and in good condition at the time of inspection. The dam exhibits little seepage, with the only seepage noted at the time of inspection occurring just to the right of the maximum section at the dam toe. According to site personnel, a small pool at the downstream toe of the maximum section of the structure appears to be associated primarily with inflow from the adjacent river rather than seepage from the ash pond.

The Gypsum Ponds consist of four structures: the gypsum storage basin; a sedimentation basin; and two clear pools, one of which is designated for extra/emergency storage. The recently constructed gypsum storage basin and 3 associated sedimentation/clarification pools were found to be in good condition at the time of inspection, with no signs of distress, settlement, or instability noted. The gypsum ponds are provided with impermeable liners, with flow carried from pool to pool by a system of decant pipes and an open channel connecting the gypsum storage pond and the sedimentation basin.

## **1.3 SUMMARY OF O&M STATUS**

The Project is attended full time by plant operators and dedicated safety personnel. The current inspection schedule for the structures redacted



redacted . The inspection for Rattlesnake Dam includes surveying of a series of six monuments positioned along the crest of the dam embedded in the upstream RCC facing block. No other instrumentation has been provided at Rattlesnake Dam or the Gypsum Ponds. At the time of inspection the structures and the plant appeared to be well maintained and in good working order. Currently, neither the Rattlesnake Dam nor the Gypsum Ponds are regulated by state or federal dam safety programs.

## 1.4 CONCLUSIONS

### 1.4.1 Project Description

The Gorgas Power Plant is a coal fired power plant. CCW byproducts of coal combustion are sluiced to on site storage ponds which appear to be well maintained and operated.

The last major revisions to the CCW storage structures include a raise of Rattlesnake Dam to provide more storage in 2007. Designs for construction of the Gypsum Ponds, both of which occurred in 2007. Designs for reconstruction projects were developed by Alabama Power or Southern Company. The structures are not regulated by any state or federal dam safety program. The structures were inspected and maintained by Alabama Power employees on a day to day basis. The structures are owned and operated by Alabama Power representatives.

### 1.4.

Field inspections were conducted to identify potential failure modes. Minimum vegetation cover was observed on the embankment between the gypsum storage pond and the Gypsum Ponds. Recommendations were developed based on field observations and a review of project documentation provided by Alabama Power.

## 1.5 SUMMARY OF RECOMMENDATIONS

There were a total of 5 recommendations resulting from the document review and field inspection. The recommendations are summarized below in *Table 1-1* and discussed in detail in **Section 4.0**.

**TABLE 1-1: SUMMARY OF RECOMMENDATIONS**

| <b>No.</b> | <b>RECOMMENDATION</b>  | <b>TIMEFRAME</b>                       |
|------------|--|--|
| 1          | Institute formal monthly visual inspection program.                    | Summer 2009                            |
| 2          | Improve condition of seepage monitoring weir at toe of Rattlesnake Dam | Summer 2009                            |
| 3          | Monitor developing cracks in RCC at Rattlesnake Dam.                   | Concurrent with annual inspections.    |
| 4          | Maintain vegetation on slopes of Gypsum Ponds                          | According to owner's existing plan.    |
| 5          | Continued vegetation control on slopes and toe of Rattlesnake Dam      | As required by 2008 Inspection Report. |

## 1.6 CERTIFICATION

### 1.6.1 List of All Field Inspection Participants

The field inspection was conducted on June 9, 2009. The individuals participating in the inspection were:

|                     |                              |
|---------------------|------------------------------|
| Karrie-Jo Shell     | USEPA                        |
| H. Grady Adkins, PE | RIZZO – Independent Engineer |
| John P. Osterle, PE | RIZZO                        |
| Conrad Ginther, EIT | RIZZO                        |
| Jim Courington      | Gorgas – Alabama Power       |
| Tracie Hill         | Gorgas – Alabama Power       |
| Susan Mayfield      | Gorgas – Alabama Power       |
| Jerry Mitchell      | Gorgas – Alabama Power       |
| Shane Lovett        | ADEM                         |
| Scott Story         | ADEM                         |
| Scott Ramsey        | ADEM                         |
| Edward Poolos       | ADEM                         |

Steven Burus, Esq.  
Tommy Ryals  
Jim Pegues

Balch and Bingham  
APC Environmental Affairs  
Southern Company

### **1.6.2 Signature of Independent Engineer**

I acknowledge that the management units referenced herein were personally inspected by me and was found to be in the following condition:

SATISFACTORY

Signature: \_\_\_\_\_  
H. Grady Adkins, PE, AL Registration No. 28790  
Independent Engineer  
Paul C. Rizzo Associates, Inc.

### **1.6.3 PE Stamp**

## 2.0 PROJECT DESCRIPTION

### 2.1 EXISTING PROJECT FEATURES AND HAZARD POTENTIAL CLASSIFICATION

#### 2.1.1 Rattlesnake Dam and Ash Pond

Rattlesnake Dam is identified as a Significant hazard structure with the ID “AL 01662” in the National Inventory of Dams. It is also referred to as Rattlesnake Hollow Dam.

Rattlesnake Dam was originally constructed as a random rockfill berm with a crest elevation around <sup>redacted</sup> ft, referred to in the provided documentation and drawings as “Stage 1”. In the mid 1970’s, the dam was raised to crest elevation <sup>redacted</sup> (Stage 2). The Stage 2 crest raise consisted of the construction of an upstream blanket intended to limit seepage through the existing and new rockfill, an intermediate sized material intended to act as a filter between the impermeable material and rockfill, and the placement of additional rockfill on the downstream shell. According to documents provided by Alabama Power, the construction of the upstream seepage blanket and intermediate filter was difficult due to the craggy surface provided by the existing rockfill surface. The Stage 2 crest raise appears to have been largely successful at reducing seepage through the structure, with only one location of notable seepage at a location around 150 feet west and downstream of the concrete culvert that had previously served as the diversion channel for the original construction. This seepage feature generally coincides with the location of seepage noted at the time of inspection, and is estimated to be on the order of 5 gpm.

In 2005, as the storage capacity of the ash pond dwindled, a feasibility study was performed to determine the available methods to raise the existing dam and the associated risks and costs of a second crest increase. The study consisted of historical document reviews, field exploration including a two phase geophysical testing program, test pits and other field sampling, and seepage and slope stability analysis of existing and proposed conditions. The resulting report, “Crest Raise Feasibility Study”, issued in October 2005 was provided by Alabama Power at the time of inspection. As a result of the Feasibility study, a cross section consisting of a <sup>redacted</sup> foot wide RCC facing block with a design slope of <sup>redacted</sup>, a core section up to <sup>redacted</sup> feet thick, a <sup>redacted</sup> foot thick fine and coarse filter section, and additional rockfill placed on the downstream shell to provide a downstream slope of

redacted was selected for the crest raise project (Stage 3), with a design crest elevation of redacted feet. According to provided calculations, it was estimated that raising the crest an additional redacted feet would provide on the order of redacted of additional ash storage.

The Stage 3 construction at Rattlesnake Dam was completed in 2007, and consisted of removal and replacement of the weir flow intake structure used to control water levels at normal conditions, a redacted foot raise of the dam crest using the typical section mentioned above, and the construction of a two bay emergency spillway with a spill elevation of redacted feet designed to pass the PMF without overtopping of the structure. The RCC facing block was installed using a paving machine without the use of water stops at construction joints and with few measures to control cracking in the RCC. The current dam crest elevation is redacted feet, and the approximate height of the dam is redacted feet.

In addition to the crest raise, an intermediate dike was constructed in the ash pond to facilitate better water quality at the discharge by limiting the travel of ash in the pond. This dike extends from the east side of the pond nearly all the way to the west side, where a narrow channel allows water to flow to Rattlesnake Dam and through the discharge structure. An HDPE bubbler line has been added in the channel to provide extra water quality treatment.

Currently, CCW byproducts are sluiced from the Gorgas combustion units, under the Black Warrior River, to the far southern (upstream) extremity of the ash pond via HDPE sluice lines. Discharge water travels through the channel at the intermediate dike and to the weir flow intake structure near the right abutment of Rattlesnake Dam, where a 4 foot diameter line carries flow to the discharge point in the river. The discharge from the ash pond is regulated by the Alabama Department of Environmental Management under NPDES Permit #AL0002909.

According to information provided by Alabama Power, the Ash Pond has an approximate area of redacted acres, is holding approximately redacted cubic yards of CCW, and has an approximate storage capacity of redacted cubic yards of CCW.

Based on field reconnaissance and a review of USGS maps and aerial photographs, the Primary Pond has been classified by the Independent Engineer as a significant hazard

potential structure due to the environmental damage that would be caused by misoperation or failure of the structure. Table 2-1 below summarizes the location information for Rattlesnake Dam.

**TABLE 2-1: RATTLESNAKE DAM LOCATION DATA**

|                  | Degrees | Minutes        | Seconds |
|------------------|---------|----------------|---------|
| <b>Longitude</b> | -87     | 11             | 08      |
| <b>Latitude</b>  | 33      | 38             | 23      |
| <b>State:</b>    | Alabama | <b>County:</b> | Walker  |

### 2.1.2 Gypsum Ponds

The Gypsum Ponds were constructed and consist of a gypsum storage basin, a sediment basin, and two clear ponds used for emergency storage. All of the Gypsum Ponds are lined with an impermeable liner and the gypsum storage pond is provided with underdrains.

The gypsum storage cell is the largest and is partially incised into a hilltop and partially diked. The embankment is on the slope between the gypsum storage pond and lower ponds, with a width of approximately 100 feet. Inside and outside slopes of the basin are constructed at a 3:1 ratio with an intermediate bench provided to either side of the crest at elevation 100 feet. A decant pipe carries water from the center of the pond through the embankment to a concrete lined trapezoidal channel that ties into the sedimentation pond via several 36 inch diameter concrete pipes. The decant structure in the storage basin is constructed such that as gypsum accumulates risers can be added to the structure to raise the decant elevation in 4 foot intervals. The structure is approximately 10 feet higher than the low point of the pond bottom. Gypsum slurry is pumped from a low point below the clear pool to the northern extremity of the gypsum storage pond.

According to information provided by Alabama Power, the gypsum storage pond has an approximate area of 100 acres, is holding approximately 100,000 cubic yards of gypsum, and has an approximate storage capacity of 100,000 cubic yards of gypsum.

The sediment pond, clear pool, and emergency storage cell were redacted and have interior slopes of redacted. Two decant pipes carry water from the sediment pond to the clear pool under normal conditions. In addition, concrete lined overflow spillways connect the sediment pond to the clear pool and the clear pool to the emergency storage cell.

Based on field reconnaissance and a review of USGS maps and aerial photographs, the Gypsum Ponds (the gypsum storage pond in particular) have been classified by the Independent Engineer as a significant hazard potential structure due to the environmental damage that would be caused by misoperation or failure of the structure. Table 2-2 below summarizes the location information for the Secondary Pond.

**TABLE 2-2: GYPSUM POND LOCATION DATA**

|                  | <b>Degrees</b> | <b>Minutes</b> | <b>Seconds</b> |
|------------------|----------------|----------------|----------------|
| <b>Longitude</b> | -87            | 13             | 02             |
| <b>Latitude</b>  | 33             | 39             | 19             |
| <b>State:</b>    | Alabama        | <b>County:</b> | Walker         |

## **2.2 SUMMARY OF STANDARD OPERATING PROCEDURES**

### **2.2.1 Purpose of the Project**

The Gorgas Plant is a coal fired power plant. Rattlesnake Dam was constructed to provide storage for waste coal combustion products and to provide necessary decantation capacity for the discharge water from the plant to comply with NPDES permit requirements. The Gypsum Ponds were constructed to provide storage for gypsum created as a byproduct of emissions scrubbing. Recent additions to the structure of Rattlesnake Dam have added an estimated additional storage capacity for on the order of redacted more ash production.

To date there have been no failures, overtopping events, or uncontrolled releases into the Black Warrior River from Rattlesnake Dam or the Gypsum Ponds. This assessment does not include discharges already recorded in NPDES records.

### **2.2.2 Current Inspection Schedule**

The current inspection schedule for the structures at Gorgas is as follows:

redacted

### **2.3 MODIFICATIONS CONDUCTED FOR PROJECT SAFETY**

In 2007 the Gypsum Ponds were constructed and Rattlesnake Dam was raised redacted. These construction projects were related to production capacity rather than dam safety improvements. redacted have been conducted since 2007.



### 3.0 FIELD INSPECTION

#### 3.1 FIELD INSPECTION OBSERVATIONS

The site inspection was conducted on June 9, 2009. The inspection team consisted of representatives from Alabama Power Company (APC), Alabama Department of Environmental Management (ADEM), Balch and Bingham, Southern Company, the USEPA, and RIZZO. The team stopped at each of the project features to inspect the structures and the surrounding area. Particular attention was paid to site features that may contribute to typical failure modes of embankment structures such as settlement, seepage, and slope stability. Photographs taken during the site inspection can be reviewed in *Appendix A*.

The individuals participating in the inspection were:

|                     |                              |
|---------------------|------------------------------|
| Karrie-Jo Shell     | USEPA                        |
| H. Grady Adkins, PE | RIZZO – Independent Engineer |
| John P. Osterle, PE | RIZZO                        |
| Conrad Ginther, EIT | RIZZO                        |
| Jim Courington      | Gorgas Plant – Alabama Power |
| Tracie Hill         | Gorgas Plant – Alabama Power |
| Susan Mayfield      | Gorgas Plant – Alabama Power |
| Jerry Mitchell      | Gorgas Plant – Alabama Power |
| Shane Lovett        | ADEM                         |
| Scott Story         | ADEM                         |
| Scott Ramsey        | ADEM                         |
| Edward Poolos       | ADEM                         |
| Steven Burus, Esq.  | Balch and Bingham            |
| Tommy Ryals         | APC Environmental Affairs    |
| Jim Pegues          | Southern Company             |

##### 3.1.1 Rattlesnake Dam

At the time of inspection, Rattlesnake Dam appeared to be well maintained and in good condition. The crest of the structure appeared well maintained and showed no signs of settlement or rutting. The upstream slope was not visible below the recently constructed RCC facing block. The downstream slope appeared to be uniformly graded, without signs

of sloughing or sliding. The abutment contacts appeared to be in good condition downstream and where visible upstream.

Vertical cracking was noted in the upstream face of the RCC near the intake weir and right abutment. See Photo 6. According to APC personnel, no construction joints were placed in the RCC facing between the abutments – a distance of approximately redacted. No area of concentrated vertical cracking was noted elsewhere on the RCC facing. The existing cracks should be monitored for change in size as part of the inspection program. The left abutment is flatter than the right abutment but may be subject to cracking due to future differential settlement. Observation of the front face of the RCC for cracking should be included in periodic inspection checklists.

The weir intake structure is a new reinforced concrete structure in excellent condition. This structure outlets into a 48-inch diameter corrugated metal pipe that carries decant water down the hill to the NPDES permitted release point. The release point is under water, therefore observation of the water at the point of discharge was not visible. Water at the point of entry was clear water. (See Photo 2).

The auxiliary spillway consists of twin box culverts through the embankment discharging into a baffle chute spillway with a rock lined trapezoidal discharge channel (tailrace) below the chute stilling basin. This spillway was constructed in 2007 and is in excellent condition. It has not experienced flow to date.

The downstream face of the dam is rockfill with no signs of sloughing or sliding. The color difference in the photographs between the upper lighter colored rock and the lower darkened colored rock is indicative of difference in exposure time between the new construction in 2007 and the older rock placed in the 1970's rather than an indication of seepage.

The downstream toe is generally grassed and clear of trees and heavy vegetation, with the exception of areas of tall brush in areas difficult to reach with tractor mowers. Seepage was noted below the toe in the left abutment area. The area around the pond in the center portion of the dam appears to be continuously wet from seepage and tailwater from the river. The pond was built during the initial dam construction. Wet areas and standing

water in tractor ruts were noted in the cleared area downstream of the dam. All were seeps of clear water with no cloudiness or indication of soil movement and may have been hillside seepage from recent rainfall.

The intermediate dike was observed from a distance and not walked. This dike serves as a baffle to enhance water quality, and with a crest elevation only slightly above normal pool, is not considered a safety risk to Rattlesnake Dam.

### **3.1.2 Gypsum Ponds**

The Gypsum Ponds complex consists of the gypsum storage pond at the upper elevation and the sediment basin and two clear pools at the lower elevation. These engineered earthfill structures are lined with HDPE welded liners and were constructed in 2007. There is no moisture on exposed slopes that would be indicative of seepage.

At the time of the inspection, the ponds appeared to be well constructed, operated, and maintained.

The ponds were found to have smooth, even, well graded slopes with spotty vegetation on the exterior slopes. The lack of grass cover is attributed to the recent regional drought since the slopes were seeded after construction. This has resulted in areas of surface erosion on the slopes as shown in Photos 34, 35, and 36. According to Alabama Power personnel, repairs to the slope erosion and vegetation is redacted. The erosion is not an immediate threat to the embankments, but should be addressed before it becomes a problem. The planned slope and vegetation repairs should help solve the threat.

redacted

### 3.2.1 Sapling Removal

**Recommendation:**

*Small saplings in rockfill dam should be removed or treated by spraying herbicide.*

**Status:**

At the time of inspection, rockfill slopes of Rattlesnake Dam appeared free of excessive vegetation, brush, and saplings.

### 3.2.2 Maintain a clear zone at dam toe

**Recommendation:**

*Vegetation along toe should be cleared to a distance of 20 feet from the dam toe. This clearing should be maintained to the extent necessary to allow inspection.*

**Status:**

At the time of inspection, the area was generally clear of heavy vegetation, with the exception of some areas of tall brush or grass in areas that appeared hard to reach with a mowing tractor. The area immediately downstream of the toe in the center portion of the dam appears to stay wet and consequently is difficult to mow.

## 4.0 RECOMMENDATIONS

A total of five recommendations were generated during the preparation of this Inspection Report. All of the recommendations are considered Dam safety items. Each recommendation is presented below along with a proposed schedule to address the recommendation

### 4.1 RECOMMENDATION NO. 1

It is recommended that the visual inspections performed by redacted be formalized in a redacted program. The program should consist of visual observation of slope conditions, general maintenance items such as vegetation control, and changes/appearances of seepage flow for both Rattlesnake Dam and the Gypsum Ponds and should include observations of any changes in depth, area, or other conditions of the toe pool and of changes in the volume of seepage at the existing seep in Rattlesnake Dam. A simple log sheet should be developed to facilitate easy reference and availability of the information for any future inspections, improvements, or remediations.

**Schedule:** Summer 2009

### 4.2 RECOMMENDATION NO. 2

In conjunction with Recommendation No. 1, the existing weir box at the toe of the downstream slope of Rattlesnake Dam should be cleaned out and repositioned, or replaced with a larger weir if necessary, to collect the seepage flow along the downstream toe observed at the time of inspection. As much of the seepage currently visible should be collected as possible and the small ditch creating the current flow path should be kept as clear as possible to facilitate observations of changes in volume, turbidity, or location of new seeps. Such information, along with the flow measured at the box should be recorded as a part of Recommendation No. 1, so that seepage trends can be established and reviewed easily. In the event of increased seepage flows, the installation of additional instrumentation and a more involved monitoring program may be warranted.

**Schedule:** In conjunction with Recommendation No. 1.

#### 4.3 RECOMMENDATION NO. 3

It is recommended that cracks in the RCC facing block of Rattlesnake Dam be monitored as they develop, and that remedial measures such as caulking or grouting be considered to treat the cracks if they are deemed a risk to the embankment materials during normal conditions or high pool events.

**Schedule:** Concurrent with Annual Inspections.

#### 4.4 RECOMMENDATION NO. 4

It is recommended that the slopes between the gypsum storage cell and the clarification basins be reseeded or otherwise provided with good vegetative cover to prevent excessive raveling of the slopes. It is our understanding that Alabama Power has a plan in place to restore and establish cover on the slopes in the near future.

**Schedule:** According to existing plans.

#### 4.5 RECOMMENDATION NO. 5

It is recommended that efforts to control vegetation in the rockfill slopes and within 20 feet of the downstream toe of Rattlesnake Dam be continued as indicated in the last inspection report.

**Schedule:**

redacted

redacted

**APPENDIX A**

**GORGAS STEAM PLANT PHOTO LOG**



**PHOTO 1: RATTLESNAKE DAM WEIR FLOW INTAKE STRUCTURE**



**PHOTO 2: CLOSEUP OF WEIR INTAKE**





**PHOTO 3: EMERGENCY SPILLWAY AND UPSTREAM FACE OF  
RATTLESNAKE DAM**

redacted

**PHOTO 4: RATTLESNAKE DAM LEFT ABUTMENT UPSTREAM CONTACT**

redacted

**PHOTO 5: RATTLESNAKE DAM RIGHT ABUTMENT UPSTREAM CONTACT**

redacted

**PHOTO 6: VERTICAL CRACKING IN RCC FACING BLOCK LEFT OF  
INTAKE STRUCTURE**

redacted

**PHOTO 7: RCC FACING ON UPSTREAM SIDE OF RATTLESNAKE DAM  
(LOOKING SW)**

redacted

**PHOTO 8: RCC FACING ON UPSTREAM SIDE OF RATTLESNAKE DAM  
(LOOKING NE)**

redacted

**PHOTO 9: RATTLESNAKE DAM DOWNSTREAM SLOPE FROM LEFT  
ABUTMENT (LOOKING SW)**

redacted

**PHOTO 10: RATTLESNAKE DAM DOWNSTREAM SLOPE FROM LEFT  
ABUTMENT (LOOKING NE)**

redacted

**PHOTO 11: EMERGENCY SPILLWAY CHUTE (LOOKING S)**

redacted

**PHOTO 12: EMERGENCY SPILLWAY (FROM DAM CREST, LOOKING N)**

redacted

**PHOTO 26: RIP RAP LINED SPILLWAY TAILRACE (LOOKING N)**

redacted



**PHOTO 13: DISCHARGE LINE FROM INTAKE STRUCTURE (LOOKING NW)**

redacted

**PHOTO 27: DISCHARGE LINE FROM RATTLESNAKE DAM TO BLACK  
WARRIOR RIVER**



**PHOTO 28: DISCHARGE INTO BLACK WARRIOR RIVER  
(NPDES PERMIT #xx)**

redacted

**PHOTO 14: ORIGINAL BYPASS CHANNEL (ABANDONED)**

redacted

**PHOTO 15: ORIGINAL BYPASS CHANNEL & CULVERT (ABANDONED,  
LOOKING S)**



**PHOTO 16: POOL AT DOWNSTREAM TOE OF RATTLESNAKE DAM  
(LOOKING W)**

redacted



**PHOTO 17: RATTLESNAKE DAM DOWNSTREAM SLOPE AND POOL AT  
TOE**

redacted

**PHOTO 18: OVERGROWN SEEPAGE MEASUREMENT WEIR**



**PHOTO 19: APPROXIMATE SOURCE LOCATION OF SEEPAGE FROM  
DOWNSTREAM TOE OF RATTLESNAKE DAM**

redacted

**PHOTO 29: VIEW ACROSS ASH POND FROM ADJACENT TO  
INTERMEDIATE DIKE (LOOKING S)**

redacted

**PHOTO 30: INTERMEDIATE DIKE IN ASH POND (LOOKING E)**

redacted



**PHOTO 31: ASH SLITCE DISCHARGE LINE (LOOKING S)**

redacted

**PHOTO 32: BUBBLER AERATION LINE AT INTERMEDIATE DIKE  
(LOOKING E)**



**PHOTO 33: GYPSUM STORAGE POND (LOOKING SE)**

redacted

**PHOTO 34: SEDIMENT POND, BACKGROUND, AND CLEAR POOL,  
FOREGROUND (LOOKING NE)**

redacted

**PHOTO 35: DECANT PIPES IN SEDIMENT BASIN**



**PHOTO 36: EROSION ON SLOPE BETWEEN ASH BASIN AND CLEAR POOL**

redacted

**PHOTO 37: SILT SOCK PLACED AS E & S CONTROL AT BASE OF ERODED  
AREA**

redacted

**PHOTO 38: PUMP STATION FROM CLEAR POOL**

redacted


## **APPENDIX B**

### **FIGURES**

|     |    |         |            |             |                 |
|-----|----|---------|------------|-------------|-----------------|
| 1=1 | BY | 6/21/09 | CHECKED BY | APPROVED BY | CAD FILE NUMBER |
|     |    |         |            |             |                 |

09-4157-B2(M)



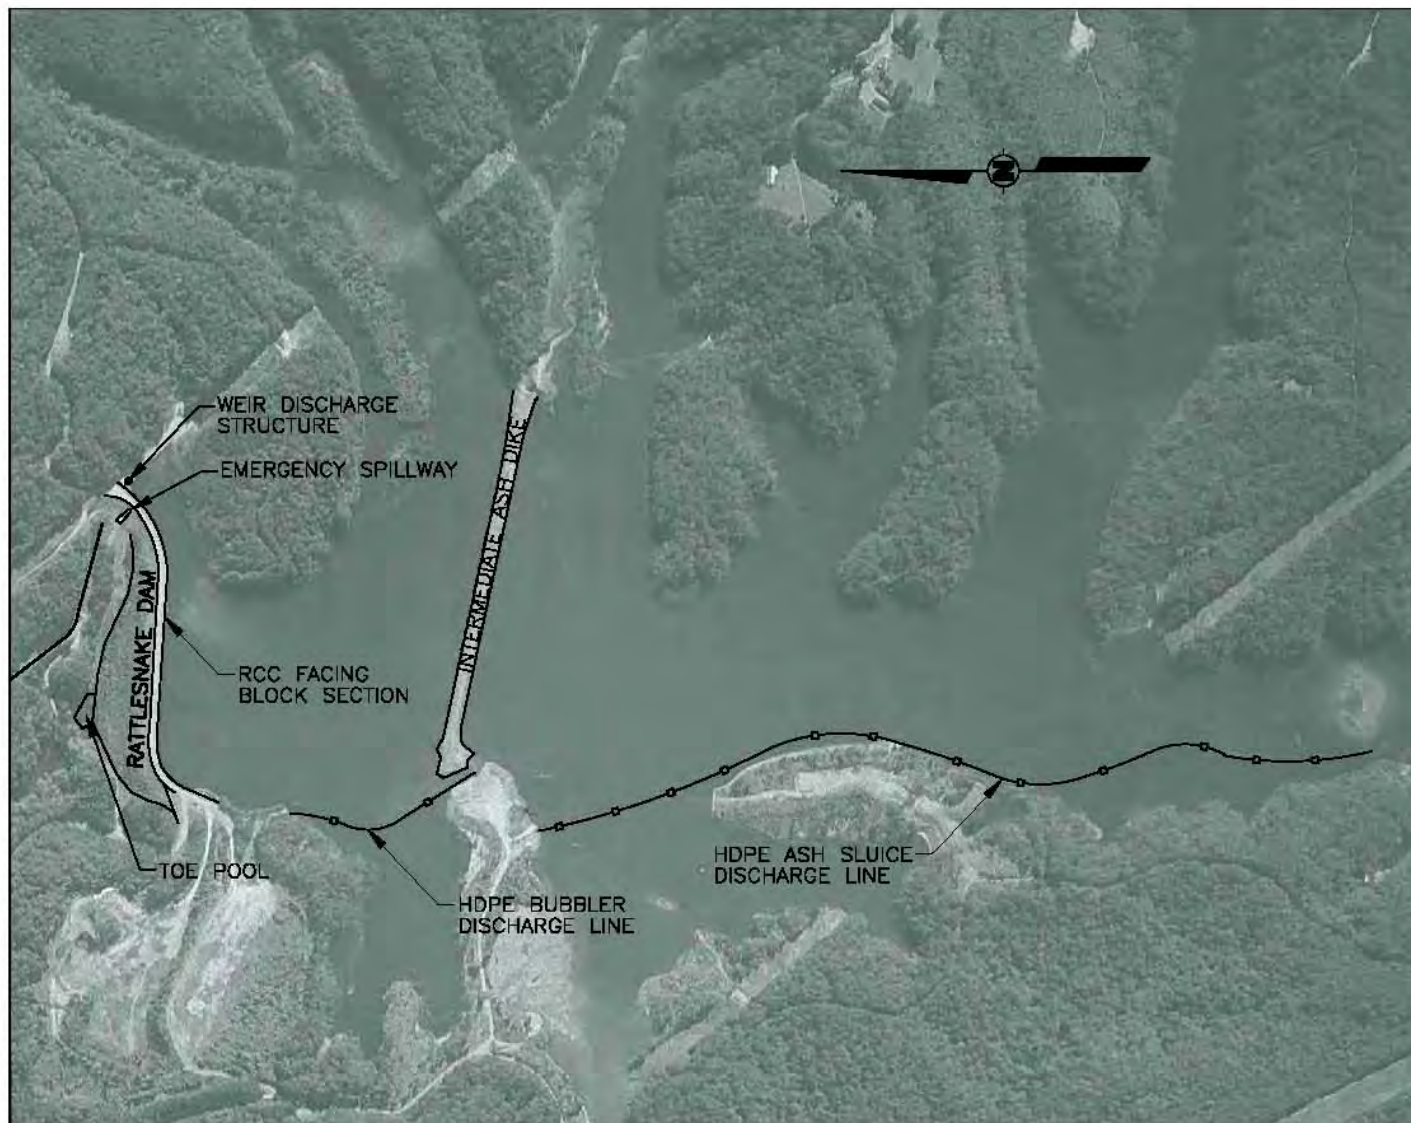

**FIGURE 2**  
 RATTLESNAKE HOLLOW  
 ASH POND AND FEATURES  
 GORGAS PLANT  
 DAM SAFETY INSPECTION  
 PREPARED FOR

USEPA  
 WASHINGTON, D.C.

NOTE: DRAWING DIGITIZED FROM HARD COPY FIGURES. NTS.





## LEGEND

- ① APPROXIMATE LOCATION OF SEEPAGE FROM TOE.
- ② CRACKING IN RCC FACING BLOCK NOTED HERE.

FIGURE 3  
RATTLESNAKE DAM  
AND FEATURES  
GORCAS PLANT  
DAM SAFETY INSPECTION  
PREPARED FOR

USEPA  
WASHINGTON, D.C.

NOTE: DRAWING DIGITIZED FROM HARD COPY FIGURES. NTS.



redacted

**APPENDIX C**

**FIELD INSPECTION CHECKLISTS**



|  |  |                  |                       |
|--|--|------------------|-----------------------|
| Site Name:   | Gorgas Steam Plant   | Date:            | 06/09/2009            |
| Unit Name:   | Gypsum Storage Facility  | Operator's Name: | Alabama Power Company |
| Unit I.D.:   | Hazard Potential Classification: High <input checked="" type="checkbox"/> Significant <input checked="" type="checkbox"/> Low <input type="checkbox"/> |                  |                       |
| Inspector's Name: Grady Adkins, John Osterle, Conrad Ginther |  |                  |                       |

Check the appropriate box below. Provide comments when appropriate. If not applicable or not available, record "N/A". Any unusual conditions or construction practices that should be noted in the comments section. For large diked embankments, separate checklists may be used for different embankment areas. If separate forms are used, identify approximate area that the form applies to in comments.

|  | Yes | No        |   | Yes | No |
|--|-----|-----------|---|-----|----|
| 1. Frequency of Company's Dam Inspections?   |     | redacted  | 18. Sloughing or bulging on slopes?   |     | ✓  |
| 2. Pool elevation (operator records)?  |     | Variable  | 19. Major erosion or slope deterioration?   |     | ✓  |
| 3. Decant inlet elevation (operator records)?  |     | Will vary | 20. Decant Pipes:   |     |    |
| 4. Open channel spillway elevation (operator records)?   |     | None      | Is water entering inlet, but not exiting outlet?  |     | ✓  |
| 5. Lowest dam crest elevation (operator records)?  |     |           | Is water exiting outlet, but not entering inlet?  |     | ✓  |
| 6. If instrumentation is present, are readings recorded (operator records)?                                  |     |           | Is water exiting outlet flowing clear?  | ✓   |    |
| 7. Is the embankment currently under construction?   |     | ✓         | 21. Seepage (specify location, if seepage carries fines, and approximate seepage rate below): |     |    |
| 8. Foundation preparation (remove vegetation, stumps, topsoil in area where embankment fill will be placed)? |     | ✓         | From underdrain?  |     | ✓  |
| 9. Trees growing on embankment? (If so, indicate largest diameter below)                                     |     | ✓         | At isolated points on embankment slopes?  |     | ✓  |
| 10. Cracks or scarps on crest?   |     | ✓         | At natural hillside in the embankment area?   |     | ✓  |
| 11. Is there significant settlement along the crest?   |     | ✓         | Over widespread areas?  |     | ✓  |
| 12. Are decant trashracks clear and in place?  | ✓   |           | From downstream foundation area?  |     | ✓  |
| 13. Depressions or sinkholes in tailings surface or whirlpool in the pool area?                              |     | ✓         | "Boils" beneath stream or ponded water?   |     | ✓  |
| 14. Clogged spillways, groin or diversion ditches?   |     | ✓         | Around the outside of the decant pipe?  |     | ✓  |
| 15. Are spillway or ditch linings deteriorated?  |     | ✓         | 22. Surface movements in valley bottom or on hillside?  |     | ✓  |
| 16. Are outlets of decant or underdrains blocked?  |     | ✓         | 23. Water against downstream toe?   |     | ✓  |
| 17. Cracks or scarps on slopes?  |     | ✓         | 24. Were Photos taken during the dam inspection?  | ✓   |    |

Major adverse changes in these items could cause instability and should be reported for further evaluation. Adverse conditions noted in these items should normally be described (extent, location, volume, etc.) in the space below and on the back of this sheet.

Inspection Issue #

Comments

2&3 - Decant inlet will be raised in 4 ft increments as gypsum accumulates. *Lowest elevation* redacted

6 - No instrumentation installed

19 - Localized surface erosion rills. Embankment was seeded after construction during drought conditions. Owner has corrective measures scheduled.

Coal Combustion Waste (CCW)  
Impoundment InspectionImpoundment NPDES Permit # N/A  
Date 06/09/09INSPECTOR Adkins, Osterle  
GintherImpoundment Name Gypsum Storage Facility  
Impoundment Company Alabama Power Company  
EPA Region IV  
State Agency (Field Office) Addresss \_\_\_\_\_Name of Impoundment \_\_\_\_\_  
(Report each impoundment on a separate form under the same Impoundment NPDES Permit number)*Entered service in 2007*

New \_\_\_\_\_ Update \_\_\_\_\_

|   | Yes      | No       |
|---|----------|----------|
| Is impoundment currently under construction?  | _____    | <u>X</u> |
| Is water or ccw currently being pumped into the impoundment? <i>No discharge at inspection date</i> | <u>X</u> | _____    |

IMPOUNDMENT FUNCTION: Gypsum StorageNearest Downstream Town : Name \_\_\_\_\_  
Distance from the impoundment \_\_\_\_\_  
Impoundment  
Location: Longitude -87 Degrees 13 Minutes 02 Seconds  
Latitude 33 Degrees 39 Minutes 19 Seconds  
State AL County WalkerDoes a state agency regulate this impoundment? YES \_\_\_\_\_ NO X

If So Which State Agency? \_\_\_\_\_

*Gypsum Pond*



**HAZARD POTENTIAL** (In the event the impoundment should fail, the following would occur):

\_\_\_\_\_ **LESS THAN LOW HAZARD POTENTIAL:** Failure or misoperation of the dam results in no probable loss of human life or economic or environmental losses.

\_\_\_\_\_ **LOW HAZARD POTENTIAL:** Dams assigned the low hazard potential classification are those where failure or misoperation results in no probable loss of human life and low economic and/or environmental losses. Losses are principally limited to the owner's property.


✓ \_\_\_\_\_ **SIGNIFICANT HAZARD POTENTIAL:** Dams assigned the significant hazard potential classification are those dams where failure or misoperation results in no probable loss of human life but can cause economic loss, environmental damage, disruption of lifeline facilities, or can impact other concerns. Significant hazard potential classification dams are often located in predominantly rural or agricultural areas but could be located in areas with population and significant infrastructure.

\_\_\_\_\_ **HIGH HAZARD POTENTIAL:** Dams assigned the high hazard potential classification are those where failure or misoperation will probably cause loss of human life.

**DESCRIBE REASONING FOR HAZARD RATING CHOSEN:**

*Considered significant since failure would result in environmental damages from discharge into river - Property damage to owner's plant. Low probability of loss of life.*

# CONFIGURATION:

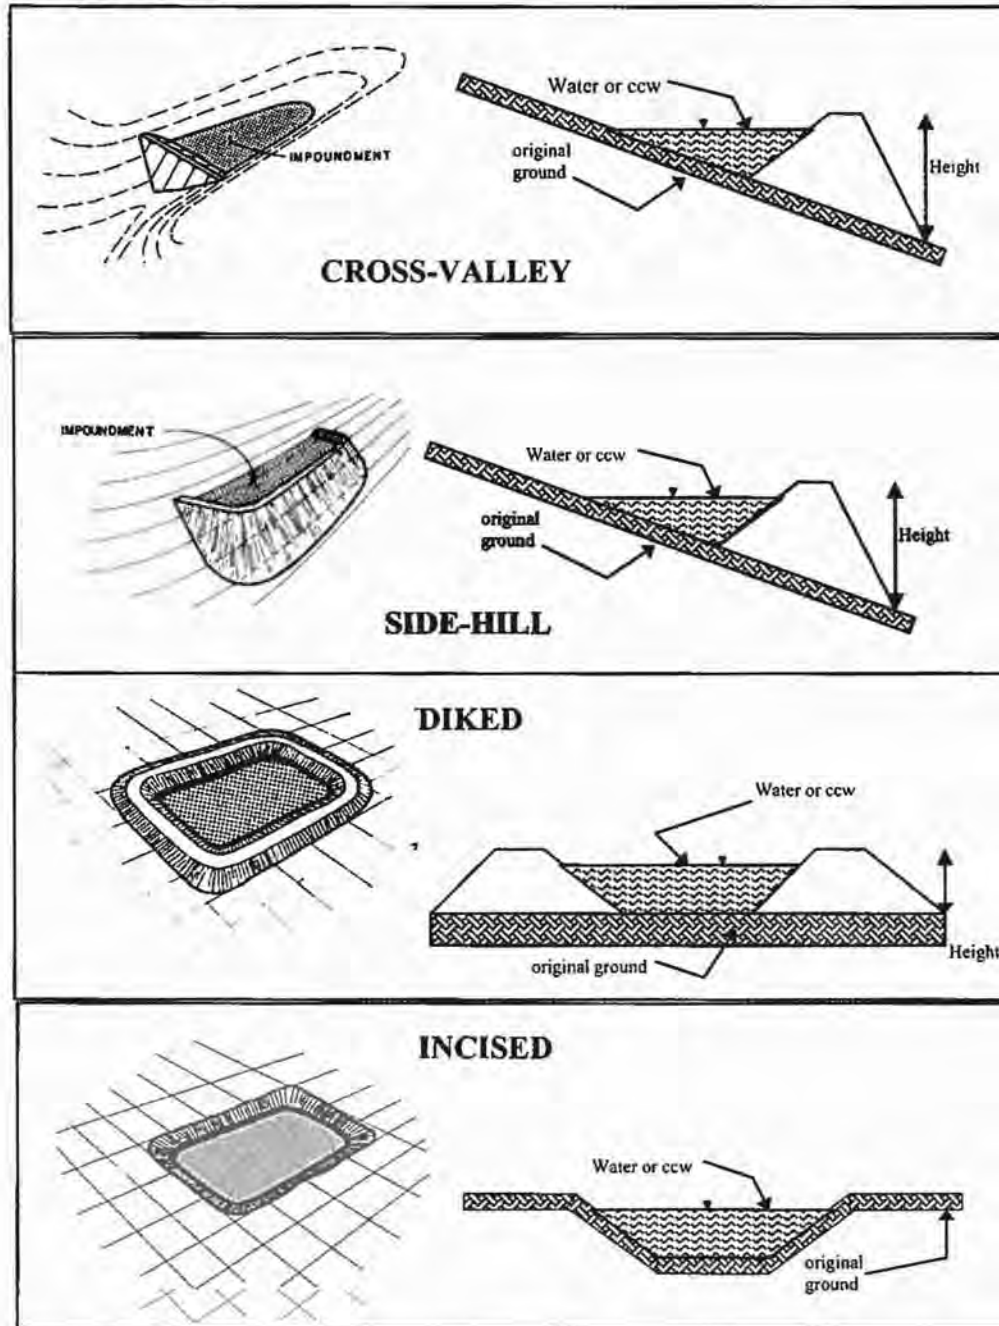

- ☐ Cross-Valley
- ☐ Side-Hill
- ☐ Diked
- ☐ Incised (form completion optional)
- ☒ Combination Incised/Diked

Embankment Height <sup>redacted</sup> \_\_\_\_\_ feet  
 Pool Area \_\_\_\_\_ acres  
 Current Freeboard \_\_\_\_\_ feet

Embankment Material Earth  
 Liner 60mil HDPE  
 Liner Permeability Very Low


**TYPE OF OUTLET** (Mark all that apply) *See next sheet*

**Open Channel Spillway**


- ☒ Trapezoidal  
☐ Triangular  
☐ Rectangular  
☐ Irregular

3' depth  
4' bottom (or average) width  
16' top width


**TRAPEZOIDAL**

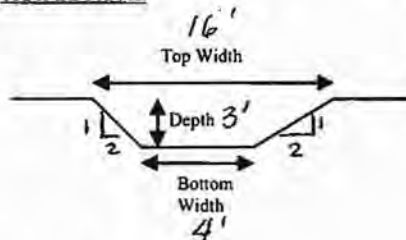


**TRIANGULAR**



**RECTANGULAR**

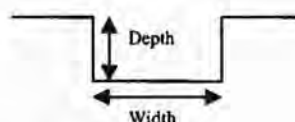

**IRREGULAR**




**Outlet** *through embankment*

48" inside diameter

**Material**

- ☐ corrugated metal  
☐ welded steel  
☒ concrete  
☐ plastic (hdpe, pvc, etc.)  
☐ other (specify) \_\_\_\_\_

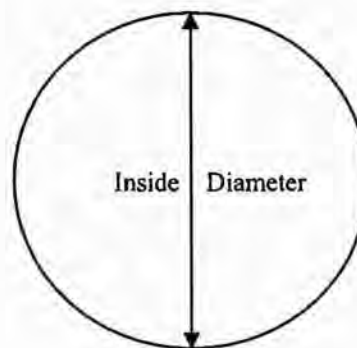

Is water flowing through the outlet? YES ☒ NO ☐

☐ **No Outlet**

☐ **Other Type of Outlet (specify)** \_\_\_\_\_

The Impoundment was Designed By Southern Company

## **OUTLET WORKS – GORGAS STEAM PLANT GYPSUM STORAGE FACILITY**

Decant water enters through two(2) 54-inch diameter HDPE riser structures and is carried through 36-inch diameter HDPE pipes to an 8-foot square reinforced concrete junction box that also collects water from the basin underdrains. From the junction box, the water flows in a 48-inch diameter RCP through the embankment into a concrete trapezoidal channel at the toe of the embankment. From the concrete channel the water flows into a sedimentation pond through three (3) 36-inch diameter RCP's.







YES \_\_\_\_\_ NO X

---

---

This image shows a full page of blank, lined paper. It features approximately 20 evenly spaced horizontal grey lines across its entire surface, typical of notebook or composition paper. There are no margins, text, or other markings present.





|  |  |                  |                       |
|--|--|------------------|-----------------------|
| Site Name:   | Gorgas Steam Plant   | Date:            | 06/09/2009            |
| Unit Name:   | Rattlesnake Hollow Ash Pond Dam  | Operator's Name: | Alabama Power Company |
| Unit I.D.:   | Hazard Potential Classification: High <input checked="" type="checkbox"/> Significant <input checked="" type="checkbox"/> Low <input type="checkbox"/> |                  |                       |
| Inspector's Name: Grady Adkins, John Osterle, Conrad Ginther |  |                  |                       |

Check the appropriate box below. Provide comments when appropriate. If not applicable or not available, record "N/A". Any unusual conditions or construction practices that should be noted in the comments section. For large diked embankments, separate checklists may be used for different embankment areas. If separate forms are used, identify approximate area that the form applies to in comments.

|  | Yes                                 | No                                  |   | Yes                                 | No                                  |
|--|-------------------------------------|-------------------------------------|---|-------------------------------------|-------------------------------------|
| 1. Frequency of Company's Dam Inspections?   |                                     | redacted                            | 18. Sloughing or bulging on slopes?   |                                     | <input checked="" type="checkbox"/> |
| 2. Pool elevation (operator records)?  |                                     |                                     | 19. Major erosion or slope deterioration?   |                                     | <input checked="" type="checkbox"/> |
| 3. Decant Inlet elevation (operator records)?  |                                     |                                     | 20. Decant Pipes:   |                                     |                                     |
| 4. Open channel spillway elevation (operator records)?   |                                     |                                     | Is water entering inlet, but not exiting outlet?  |                                     | <input checked="" type="checkbox"/> |
| 5. Lowest dam crest elevation (operator records)?  |                                     |                                     | Is water exiting outlet, but not entering inlet?  |                                     | <input checked="" type="checkbox"/> |
| 6. If instrumentation is present, are readings recorded (operator records)?                                  | <input checked="" type="checkbox"/> |                                     | Is water exiting outlet flowing clear?  | <input checked="" type="checkbox"/> |                                     |
| 7. Is the embankment currently under construction?   |                                     | <input checked="" type="checkbox"/> | 21. Seepage (specify location, if seepage carries fines, and approximate seepage rate below): |                                     |                                     |
| 8. Foundation preparation (remove vegetation, stumps, topsoil in area where embankment fill will be placed)? | <input checked="" type="checkbox"/> |                                     | From underdrain?  |                                     | <input checked="" type="checkbox"/> |
| 9. Trees growing on embankment? (If so, indicate largest diameter below)                                     |                                     | <input checked="" type="checkbox"/> | At isolated points on embankment slopes?  |                                     | <input checked="" type="checkbox"/> |
| 10. Cracks or scarps on crest?   |                                     | <input checked="" type="checkbox"/> | At natural hillside in the embankment area?   |                                     | <input checked="" type="checkbox"/> |
| 11. Is there significant settlement along the crest?   |                                     | <input checked="" type="checkbox"/> | Over widespread areas?  |                                     | <input checked="" type="checkbox"/> |
| 12. Are decant trashracks clear and in place?  | <input checked="" type="checkbox"/> |                                     | From downstream foundation area?  | <input checked="" type="checkbox"/> |                                     |
| 13. Depressions or sinkholes in tailings surface or whirlpool in the pool area?                              |                                     | <input checked="" type="checkbox"/> | "Boils" beneath stream or ponded water?   |                                     | <input checked="" type="checkbox"/> |
| 14. Clogged spillways, groin or diversion ditches?   |                                     | <input checked="" type="checkbox"/> | Around the outside of the decant pipe?  |                                     | <input checked="" type="checkbox"/> |
| 15. Are spillway or ditch linings deteriorated?  |                                     | <input checked="" type="checkbox"/> | 22. Surface movements in valley bottom or on hillside?  |                                     | <input checked="" type="checkbox"/> |
| 16. Are outlets of decant or underdrains blocked?  |                                     | <input checked="" type="checkbox"/> | 23. Water against downstream toe?   | <input checked="" type="checkbox"/> |                                     |
| 17. Cracks or scarps on slopes?  |                                     | <input checked="" type="checkbox"/> | 24. Were Photos taken during the dam inspection?  | <input checked="" type="checkbox"/> |                                     |

Major adverse changes in these items could cause instability and should be reported for further evaluation. Adverse conditions noted in these items should normally be described (extent, location, volume, etc.) in the space below and on the back of this sheet.

| Inspection Issue # | Comments   |
|--------------------|--|
| 1 & 6. Previous    | redacted ; monitor movement  |
|                    | and settlement   |
| 20.                | Decant water entering pipe is clear. Outlet is underwater discharge. |
| 21.                | Very minor seepage observed  |
| 23.                | Small pond at downstream toe has existed since initial construction  |
|                    |  |
|                    |  |
|                    |  |
|                    |  |
|                    |  |



Coal Combustion Waste (CCW)  
Impoundment Inspection

Impoundment NPDES Permit # AL0002909 INSPECTOR Adkins, Osterle, Ginther  
Date Issued Sep 6, 2007, Expires Sep 5, 2012 06/09/09  
Receiving Waters: Mulberry Fork of the Black Warrior River and Bakers Creek.  
Impoundment Name Rattlesnake Hollow Ash Pond Dam  
Impoundment Company Alabama Power Company  
EPA Region IV  
State Agency (Field Office) Address AL Department of Environmental Management (ADEM)  
1400 Coliseum Blvd, Montgomery, AL 36110

Name of Impoundment \_\_\_\_\_  
(Report each impoundment on a separate form under the same Impoundment NPDES Permit number)

New \_\_\_\_\_ Update \_\_\_\_\_

|  | Yes      | No       |
|--|----------|----------|
| Is impoundment currently under construction?                 | _____    | <u>X</u> |
| Is water or ccw currently being pumped into the impoundment? | <u>X</u> | _____    |

IMPOUNDMENT FUNCTION: Ash Storage

Nearest Downstream Town : Name \_\_\_\_\_  
Distance from the impoundment \_\_\_\_\_  
Impoundment  
Location: Longitude -87 Degrees 11 Minutes 08 Seconds  
Latitude 33 Degrees 38 Minutes 23 Seconds  
State AL County Walker

Does a state agency regulate this impoundment? YES \_\_\_\_\_ NO X Dam Safety

If So Which State Agency? Discharge only regulated by ADEM

**HAZARD POTENTIAL** (In the event the impoundment should fail, the following would occur):

           **LESS THAN LOW HAZARD POTENTIAL:** Failure or misoperation of the dam results in no probable loss of human life or economic or environmental losses.

**LOW HAZARD POTENTIAL:** Dams assigned the low hazard potential classification are those where failure or misoperation results in no probable loss of human life and low economic and/or environmental losses. Losses are principally limited to the owner's property.

✓ **SIGNIFICANT HAZARD POTENTIAL:** Dams assigned the significant hazard potential classification are those dams where failure or misoperation results in no probable loss of human life but can cause economic loss, environmental damage, disruption of lifeline facilities, or can impact other concerns. Significant hazard potential classification dams are often located in predominantly rural or agricultural areas but could be located in areas with population and significant infrastructure.


**HIGH HAZARD POTENTIAL:** Dams assigned the high hazard potential classification are those where failure or misoperation will probably cause loss of human life.

**DESCRIBE REASONING FOR HAZARD RATING CHOSEN:**

Considered significant since failure would result in damage to plant as well as environmental damage. Low probability of loss of life.

[illegible]

## CONFIGURATION:

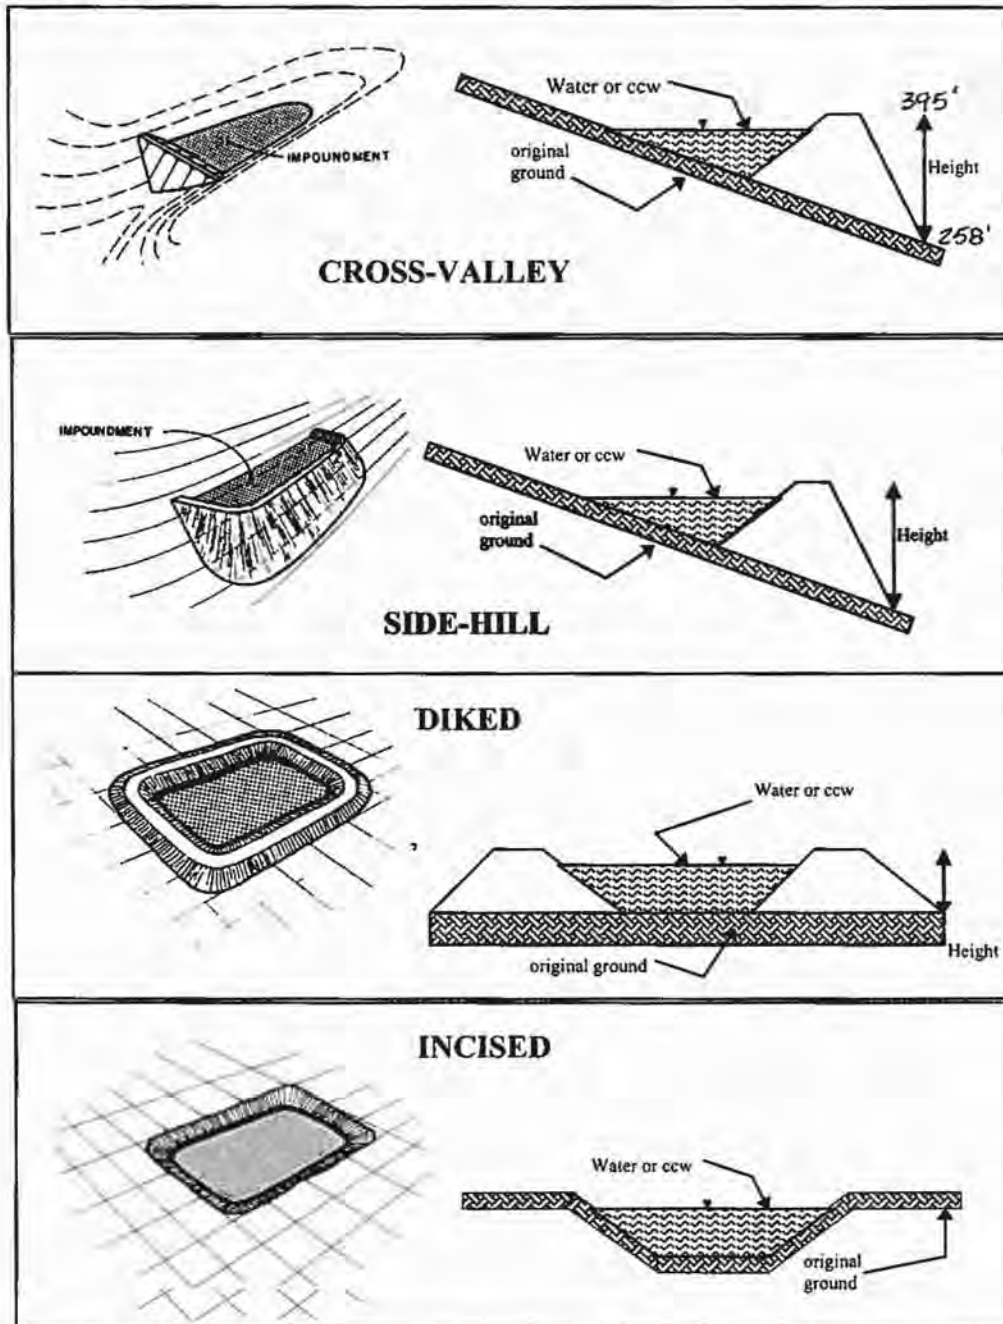

- ☒ Cross-Valley
- ☐ Side-Hill
- ☐ Diked
- ☐ Incised (form completion optional)
- ☐ Combination Incised/Diked

Embankment Height \_\_\_\_\_ feet  
 Pool Area \_\_\_\_\_ acres  
 Current Freeboard \_\_\_\_\_ feet

Upstream - Earth Fill, RCC top <sup>redacted</sup>  
 Center - Earth Fill core  
 Rock Fill Downstream





Embankment Material Combination  
 Liner None  
 Liner Permeability N/A

**TYPE OF OUTLET** (Mark all that apply)

*Emergency/Auxiliary Spillway - Twin Box Culvert Inlet to Baffled Chute*  
**Open Channel Spillway** TRAPEZOIDAL (5' H x 7' W) TRIANGULAR Spillway

- ☐ Trapezoidal  
☐ Triangular  
☒ Rectangular  
☐ Irregular


5' depth  
15' bottom (or average) width  
15' top width

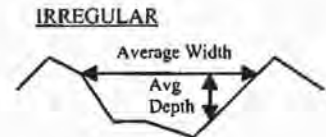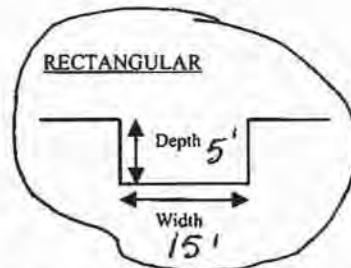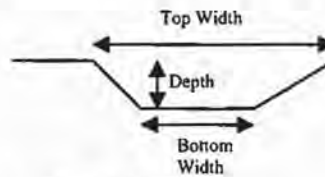

**Outlet**

48" inside diameter

*Primary Spillway - Weir Box Intake Structure in reservoir with a 2 ft of 48" CMP to outlet*

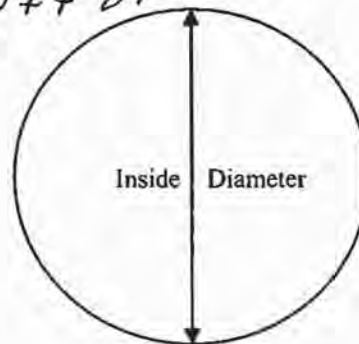

**Material**

- ☒ corrugated metal  
☐ welded steel  
☐ concrete  
☐ plastic (hdpe, pvc, etc.)  
☐ other (specify) \_\_\_\_\_

Is water flowing through the outlet? YES ☒ NO ☐

**No Outlet**

**Other Type of Outlet (specify)** \_\_\_\_\_

The Impoundment was Designed By Southern Company







YES \_\_\_\_\_ NO X

If so Please Describe : \_\_\_\_\_

Rattlesnake